

DUTY ON WHICH ENGAGED: Section formation exercise.	COURT OF INQUIRY, INVESTIGATING OFFICER OR COMMANDING OFFICER'S REPORT:
) Engine failure, force landed.in open swamp.	DATE: 27 Feb./43 COMPOSITION: F.L. C.G. Houston (C2730) #19 Sub Repair Depot. RECOMMENDATIONS:
) PRIMARY CAUSE:) 54. Engine failure in the air.) 5-of the 16 impact tubes choked	A good forced landing was carried out and pilot used) good gudgment. Since the cause of the crash was engine failure, There is no way in which it could be avoided.
1. Threed Lattling	ACTION TAKEN: (A) DISCIPLINARY (B) TECHNICAL (C) OTHER RECOMMENDATIONS FOR PREVENTION OF FURTHER ACCIDENTS OF THIS TYPE (a) Modification to be carried out to prevent snow & ice particles being drawn into air recent snow a like the particles being drawn into air recent snow a like the particles being drawn into a like
SECONDARY CAUSE OR CONTRIBUTING FACTORS: The engine may have been overchoked faulty mechanism. La Engine Deputy of the contribution of the contr	ice particles being drawn into air scoop on run- up and take offs.(b) Service instructions for Pack- ard Merlin Engines should detail precautions to be taken to ensure proper positioning of brass shims used above spring in main discharge nozzle body. CHECKED BY DATE