200			CIDEN			FICATION		2/30/37/36/	/3 ^{to} /3 ^{to} /2	3/3/2/1
	UNIT 123 Squadron COM.	- 11				Doctor	DATE20.		L535	
1 0	Debert EAC	No.				26.30 W.	 	1100-4-75	NIGHT	8 / /
TYPE OF	A/C TYPE Lysander II	100		475	CAT.	н В	x	x		OMMAND
<u>/</u> }	PERSONNEL	RANK NUME		EP DU	INJUR		IES	SIGNAL		~//
	Hewson, G.W.	P/0	J 211	52	P _	Nil		No.	DATE	1//1
								All9	21.6	3
2 TINU F								No. 2		Z T FORCED L'HU HO
TYPE OF	And Address to the Control of the Co		MA AND			4.40,40		#5		N TRANIL
1	ENGINE ENGINE NUM	1BER (S			HOURS FLO		WN BY	PILOTS		TAGE OF TAKE
/	Perseus A153178/PR22366	Seric	usly	INST.	NIGH	т ———	TYPE	ТОТ		THOUSE TO ALL
ORY				41	22	60	l DUAL	290	90	[[[[[] [] [] [] [] [] [] [] [
CATEG				•						1 2 14 14 2 40
		A C	CIDE	NT CI	. A S S	IFICATION	_ <u>_l</u>			1 100
	1/3/1/0/0/0/0/0/0/0/0/0/0/0/0/0/0/0/0/0/	/, /,	,3/,	b/.5/.	6/1	(0/0/0/	1 12/1	3/24/25/20	12/20/1	20/30/24/2

TECHNICAL OFFICER'S REPORT: Carburettor was assemb-PURPOSE OF FLIGHT: Beam X C - training. led following cleaning and tests proved the float level abnormally high and needle valves to be defec-NATURE OF ACCIDENT: tive in not effectively stopping flow of fuel into Engine failed, vilot attempted to the float chambers COURT OF INCUIRY OF INVESTIGATING OFFICER'S REPORT: land on the sand beach and overturned FINDINGS: SUMMARY No. when A/C went into the water. This accident was due to erroneous use of the engine controls in that the pilot operated the engine for a protracted period with the mixture control in the "normal" or "rich" position, thereby exhausting his fuel supply. Suggested that Pilots' Notes be drawn up for this aircraft and distributed. CLASSIFICATION: 14. Misuse of controls. SECONDARY OR CONTRIBUTORY FACTORS: 54. Engine failure in the air ACTION TAKEN: 111 R. C. A. F. L 20 (REVISED) 7M-4-43 (3202) K.P. 5051